


Final Report

Seymour
Beacon Falls
Naugatuck
Waterbury

Route 8

Interchanges 22-30 Deficiencies/Needs Study

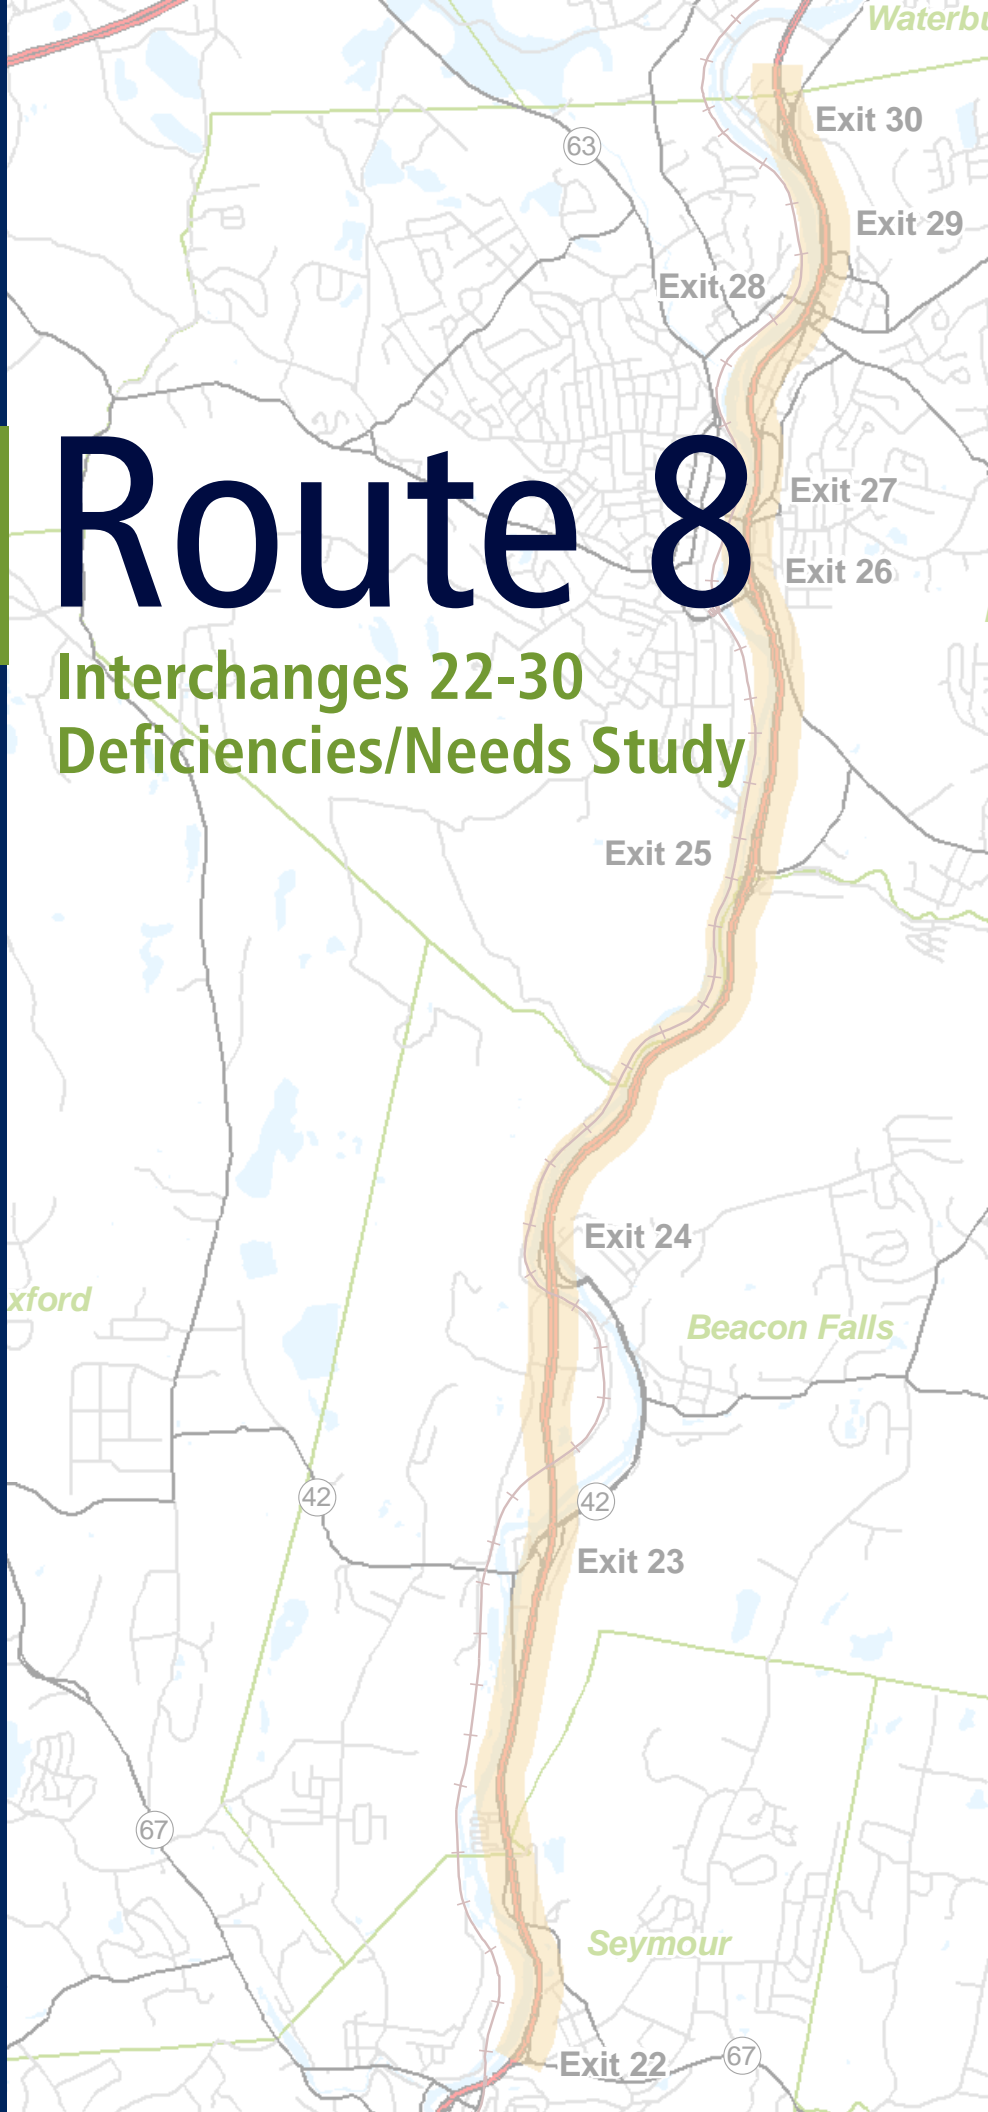

prepared for:



prepared by:


Vanasse Hangen Brustlin, Inc. 

June 2011

Route 8-Interchanges 22-30 Deficiencies/Needs Study

Seymour, Beacon Falls,
Naugatuck, and Waterbury

Prepared for **The Connecticut Department of Transportation**
2800 Berlin Turnpike
P.O. Box 31756
Newington, CT 06131
(860) 594-2000

Prepared by  ***Vanasse Hangen Brustlin, Inc.***
101 Walnut Street
P.O. Box 9151
Watertown, MA 02471

June 2011

Table of Contents

1	Introduction	1-1
1.1	Study Goals and Objectives.....	1-1
1.2	Study Area	1-2
1.3	Study Process.....	1-4
1.4	Public Participation	1-5
1.5	Study Team.....	1-5
2	Existing Transportation Conditions.....	2-1
2.1	Study Area Demographics.....	2-1
2.2	Existing Traffic Demand.....	2-2
2.2.1	Daily Volumes	2-2
2.2.2	Peak Hour Volumes	2-2
2.2.3	Surface Street Traffic Volumes	2-4
2.2.4	Trucks	2-4
2.2.5	Mainline Speeds.....	2-6
2.3	Geometrics.....	2-7
2.3.1	Methodology/Review of Geometrics	2-7
2.3.2	Mainline Geometry Review	2-9
2.3.3	Ramp Geometry.....	2-11
2.4	Structural Conditions Review.....	2-17
2.4.1	Operational Conditions.....	2-17
2.4.2	Physical Conditions.....	2-20
2.5	Existing Traffic Operations.....	2-21
2.5.1	Methodology/Criteria	2-22
2.5.2	Mainline Operations	2-22
2.5.3	Ramp Operations	2-31
2.5.4	Weaves	2-33
2.5.5	Intersections.....	2-35
2.6	Safety Analysis	2-47
2.6.1	Methodology.....	2-47
2.6.2	Quantitative Data	2-47
2.6.3	Review of Route 8 Accident Locations.....	2-49
2.6.4	Local Intersections	2-52
2.7	Multi- Modal Transportation Services	2-54
2.7.1	Metro North Railroad.....	2-54
2.7.2	Park and Ride Facilities	2-55

	2.7.3	Transit	2-56
	2.7.4	Bicycle and Pedestrian Access	2-57
2.8		Intelligent Transportation Systems (ITS).....	2-62
3	Existing Environmental Conditions		3-1
3.1		Community Resources.....	3-2
	3.1.1	Sensitive Noise Receptors	3-2
	3.1.2	Land Use, Community Planning and Municipal Facilities	3-5
	3.1.3	Local, Regional and State Land Use Plans.....	3-9
3.2		Natural Resources	3-13
	3.2.1	Surface Water Resources	3-13
	3.2.2	Wetlands	3-16
	3.2.3	Floodplains and Stream Channel Encroachment Lines	3-18
	3.2.4	Groundwater Resources	3-19
	3.2.5	Endangered Species.....	3-20
	3.2.6	Farmland Soils	3-22
3.3		Cultural and Recreational Resources	3-23
	3.3.1	Cultural Resources.....	3-23
	3.3.2	Section 4 (f) and 6 (f) Lands.....	3-28
3.4		Other Environmental Factors	3-30
	3.4.1	Hazardous Materials	3-30
	3.4.2	Environmental Justice	3-30
4	Future Transportation Conditions		4-1
4.1		Forecasting Future Traffic Conditions – 2008 to 2030	4-1
	4.1.1	Study Area Land Use Update	4-2
4.2		Future Traffic Demand – Year 2030	4-4
	4.2.1	2030 Daily Volumes	4-4
	4.2.2	2030 Peak Hour Volumes	4-5
	4.3.1	Mainline Operations	4-7
	4.3.2	Ramp Operations	4-15
	4.3.3	Weaves	4-17
	4.3.4	Intersections.....	4-18
	4.3.5	Comparison of Existing and Future Conditions.....	4-29
5	Deficiencies and Needs Summary		5-1
5.1		Existing Conditions (Year 2008)	5-1
	5.1.1	Geometric Assessment	5-1
	5.1.2	Structural Evaluation	5-2
	5.1.3	Traffic Operations.....	5-2
	5.1.4	Safety.....	5-3
5.2		Future Conditions – Year 2030	5-4
	5.2.1	Traffic Demand.....	5-4
	5.2.2	Traffic Operations.....	5-4
5.3		Summary of Deficiencies	5-6

6	Alternatives Screening Process	6-1
6.1	Introduction	6-1
6.2	Alternatives Identification / Initial Evaluation Process.....	6-1
6.3	Alternatives Refinement and Second Level Screening.....	6-4
7	Recommendations	7-1
7.1	Study Goals and Objectives.....	7-1
7.2	Description of Proposed Corridor Recommendations.....	7-2
7.3	Summary of Recommendations.....	7-36
7.4	Financial Plan	7-41

Appendix

A	Cost Estimates
B	Correspondence

List of Tables

Table No.	Description	Page
Table 2-1	Study Area Demographics/Trip Generation	2-1
Table 2-2	Route 8 Average Annual Daily Traffic Volumes (AADT)	2-2
Table 2-3	Route 8 Peak Hour Mainline Volumes – 2008 Existing Conditions	2-3
Table 2-4	Vehicle Classification Study Results	2-5
Table 2-5	Route 8 - Mainline Design Criteria	2-8
Table 2-6	Route 8 - Mainline Geometry Compliance - Northbound	2-9
Table 2-7	Route 8 – Mainline Geometry Compliance - Southbound	2-10
Table 2-8	Route 8 On-ramp Locations - Geometric Assessment	2-12
Table 2-9	Route 8 Off-Ramp Locations -- Geometric Assessment	2-13
Table 2-10	Route 8 - Bridge Structure Summary	2-18
Table 2-11	Route 8 - Bridge Operational Conditions Summary	2-19
Table 2-12	Route 8 - Bridge Physical Conditions Summary	2-20
Table 2-13	Summary of Route 8 Freeway Segment Analysis - 2008 Existing Conditions	2-24
Table 2-14	Route 8 Ramp Level of Service Analysis Summary – 2008 Existing Conditions	2-32
Table 2-15	Route 8 Weaving Sections Level of Service Analysis Summary 2008 Existing Conditions	2-35
Table 2-16	Signalized Intersection Level of Service Summary 2008 Existing Conditions	2-37
Table 2-17	Unsignalized Intersection Level of Service Summary 2008 Existing Conditions	2-38
Table 2-18	Total Study Area Accidents by Year	2-48
Table 2-19	Vehicle Classification for Accidents in Study Area	2-48
Table 2-20	Road Surface Conditions for Accidents in Study Area	2-49
Table 2-21	Contributing Factors for Accidents in Study Area	2-49
Table 2-22	Accident Summary for Local Intersections (2005 to 2007)	2-53
Table 2-23	Waterbury Branch Parking	2-55
Table 2-24	Route 8 Corridor Park and Ride Lots	2-55
Table 3-1	Noise Sensitive Receptors within Route 8 Study Area	3-3
Table 3-2	Public Safety Facilities and Community Distributions within the Study Area ..	3-9

Table 3-3	Connecticut Surface Water Quality Classifications.....	3-15
Table 3-4	Stream Crossings within the Route 8 Study Area.....	3-16
Table 3-5	Wetlands within the Route 8 Study Area	3-17
Table 3-6	CTDEP Groundwater Quality Classifications in Study Area	3-20
Table 3-7	Known Historic Resources within the Route 8 Study Area	3-24
Table 3-8	Potential Section 4(f) Resources (non-Historic) within the Route 8 Study Area	3-29
Table 3-9	Hazardous Material Sites within the Route 8 Study Area	3-31
Table 3-10	Demographic Data for the Study Area Compared to State of Connecticut ...	3-32
Table 3-11	Environmental Data for the Route 8 Study Area – Minority and Below-Poverty Populations	3-34
Table 4-1	Route 8 Mainline Average Daily Traffic Volumes (ADT) Comparison 2008 to 2030	4-5
Table 4-2	Route 8 Mainline Peak Hour Volume Comparison -- 2008 to 2030	4-6
Table 4-3	Route 8 Mainline Peak Hour Volumes- 2030 Future Conditions	4-7
Table 4-4	Summary of Freeway Segment Analysis – 2030 Future Conditions.....	4-8
Table 4-5	Route 8 Ramp Level-of-Service Analysis Summary - 2030 Future Conditions.....	4-16
Table 4-6	Route 8 Weaving Sections Level of Service Analysis Summary 2030 Future Conditions.....	4-17
Table 4-7	Signalized Intersection Level of Service Summary - 2030 Future Conditions.....	4-19
Table 4-8	Unsignalized Intersection Level of Service Summary - 2030 Future Conditions.....	4-20
Table 4-9	Route 8 Study Area – Comparison of Existing and Future Study Area Traffic Conditions 2008 to 2030	4-29
Table 5-1	Comparative Levels of Service for Freeway Segments (Existing vs. 2030 Conditions)	5-5
Table 5-2	Route 8 Interchanges 22 through 30 Summary of Deficiencies/Needs	5-7
Table 7-1	Mainline LOS Analysis (2030 Future Conditions): Existing and Widened Cross Sections.....	7-34
Table 7-2	Recommended Near Term Improvements.....	7-37
Table 7-3	Recommended Medium Term Improvements.....	7-38
Table 7-4	Recommended Long Term Improvements	7-39
Table 7-5	Funding Sources for Roadway Improvements.....	7-44
Table 7-6	Recommended Improvements for Valley Council of Governments (Seymour).....	7-45
Table 7-7	Recommended Improvements for Council of Governments of Central Naugatuck Valley	7-46

List of Figures

Figure No.	Description	Page
Figure 1-1	1-3
Figure 1-2	1-4
Figure 2-1 (Sheet 1)	2-14
Figure 2-1 (Sheet 2)	2-15
Figure 2-1 (Sheet 3)	2-16
Figure 2-2 (Sheet 1)	2-25
Figure 2-2 (Sheet 2)	2-26
Figure 2-2 (Sheet 3)	2-27
Figure 2-3 (Sheet 1)	2-28
Figure 2-3 (Sheet 2)	2-29
Figure 2-3 (Sheet 3)	2-30
Figure 2-4 (Sheet 1)	2-41
Figure 2-4 (Sheet 2)	2-42
Figure 2-4 (Sheet 3)	2-43
Figure 2-5 (Sheet 1)	2-44
Figure 2-5 (Sheet 2)	2-45
Figure 2-5 (Sheet 3)	2-46
Figure 4-1 (Sheet 1)	4-9
Figure 4-1 (Sheet 2)	4-10
Figure 4-1 (Sheet 3)	4-11
Figure 4-2 (Sheet 1)	4-12
Figure 4-2 (Sheet 2)	4-13
Figure 4-2 (Sheet 3)	4-14
Figure 4-3 (Sheet 1)	4-23
Figure 4-3 (Sheet 2)	4-24
Figure 4-3 (Sheet 3)	4-25
Figure 4-4 (Sheet 1)	4-26
Figure 4-4 (Sheet 2)	4-27
Figure 4-4 (Sheet 3)	4-28
Figure 7-1	7-4

Figure 7-2 (Sheet 1)	7-5
Figure 7-2 (Sheet 2)	7-6
Figure 7-2 (Sheet 3)	7-7
Figure 7-3	7-8
Figure 7-4	7-9
Figure 7-5	7-10
Figure 7-6	7-11
Figure 7-7	7-13
Figure 7-8	7-16
Figure 7-9 (Sheet 1)	7-17
Figure 7-9 (Sheet 2)	7-18
Figure 7-10	7-19
Figure 7-11	7-20
Figure 7-12	7-21
Figure 7-13	7-22
Figure 7-14	7-23
Figure 7-15	7-25
Figure 7-16	7-26
Figure 7-17	7-28
Figure 7-18 (Sheet 1)	7-29
Figure 7-18 (Sheet 2)	7-30
Figure 7-18 (Sheet 3)	7-31
Figure 7-19	7-32